



Description	Material	Finish
Body	Brass	Nickel
Socket	Brass	Gold
Insulation	PTFE	N/A
Crimp Ring	Brass	Nickel
O Ring	SI Rubber	Rubber
Washer	Brass	Nickel
Nut	Brass	Nickel


REVISIONS			
REV	DESCRIPTION	DATE	APPV
B	Added New Title Block	12-JUL-12	SAH

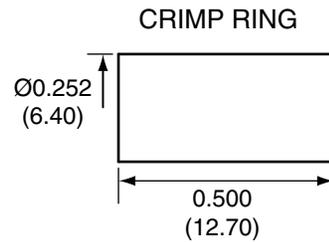


**RECOMMENDED MOUNTING HOLE**

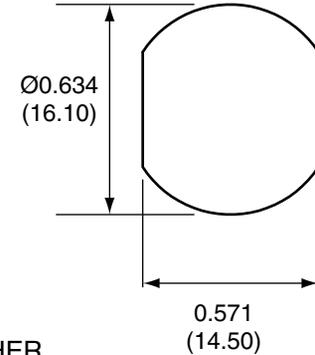


**SIDE VIEW**

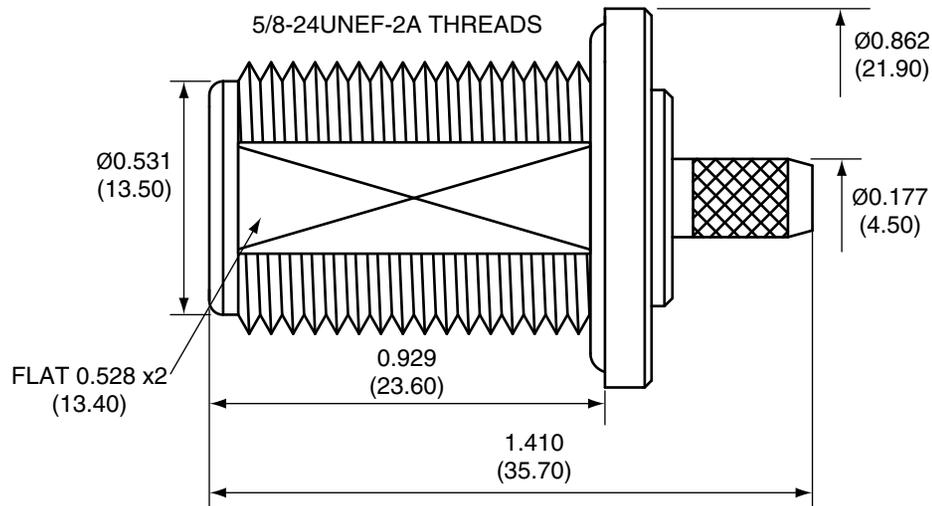


**SOCKET**

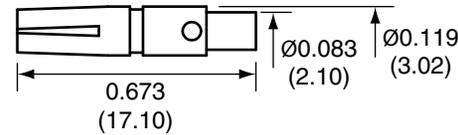


**NUT**

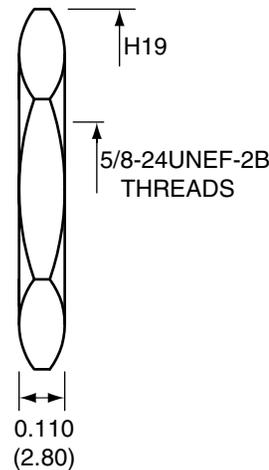

**WASHER**

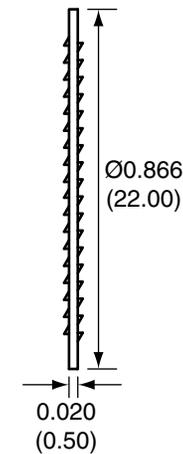

**RECOMMENDED CABLE STRIPPING DIMENSIONS**

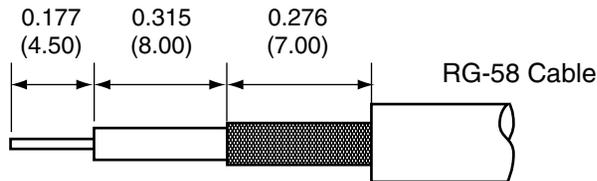

**NOTES: (UNLESS OTHERWISE SPECIFIED)**

- ALL DIMENSIONS ARE IN INCHES [mm].
- DIMENSIONS APPLY AFTER FINISHING.
- MANUFACTURE TO BE COMPLIANT WITH EU RoHS DIRECTIVE.
- SAFETY BREAK ALL SHARP CORNERS AND EDGES .02 MAXIMUM.

**WARNING:** THIS DRAWING CONTAINS PROPRIETARY INFORMATION THAT IS THE SOLE PROPERTY OF LINX TECHNOLOGIES, AND SHALL BE TREATED AS SUCH. NO DISCLOSURE OR REPRODUCTION OF THIS DOCUMENT IS PERMITTED, IN WHOLE OR IN PART, WITHOUT THE EXPRESS WRITTEN PERMISSION OF LINX TECHNOLOGIES OR ITS DESIGNATED AGENTS.

MATERIAL:	TOLERANCES: .020 [0.50]-.200 [5.00]= ±.008 [0.20] .200 [5.00]-1.200 [30.00]= ±.016 [0.40] 1.20 [30.0]-4.75 [120.0]= ±.024 [0.60] 4.75 [120.0]-12.40 [315.0]= ±.040 [1.0]	PROJECTION: 
FINISH:	DRAWN: B.MURPHY	DT: 12-JUL-12
	ENGR: S.HOGAN	DT: 12-JUL-12

**Linx**

159 ORT LANE  
MERLIN, OR 97532

TITLE:  
N FEMALE BULKHEAD MOUNT  
CABLE END CRIMP FOR RG158 CABLE

SIZE	DWG. NO.	REV
<b>A</b>	CONN005-R58	<b>B</b>
SCALE: 2:1	DO NOT SCALE DRAWING	SHEET 1 OF 1

**CONN005-R58 ASSEMBLY INSTRUCTIONS**

- Solder the socket to the center conductor.
- Insert the socket, center conductor, and insulator into the body.
- Wrap the braid around the tail of the body and crimp the ring with a hex crimp tool labeled for use with RG-58 cable.